

ATOSA Catering Equipment INC.



TO COOK NICELY!

www.atosausa.com



CookRite

ATOSA Catering Equipment INC.

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Version: C2017-2





Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | www.atosausa.com California,Colorado,Florida,Georgia, Illinois,Massachusetts,New Jersey,Ohio,Texas, Washington





Warehouse in The USA



California Headquarters	1225 W. Imperial Hwy, Brea, CA 92821	Tel:(909)-595-2688 Fax:(909)-595-7688 Email:socal@atosausa.com
Arlington, TX	407 113th Street Arlington, TX 76011	Tel:(817)-385-0890 Fax:(817)-385-0894 Email:dallas@atosausa.com
Atlanta, GA	7575-A Ponce De Leon Circle Doraville, GA 30340	Tel:(770)-248-9797 Fax:(770)-248-9799 Email:atlanta@atosausa.com
Boston, MA	203 Flanders Rd. Westborough, MA 01581	Tel:(508)-329-6031 Fax:(508)-329-6030 Email:boston@atosausa.com
Denver, CO	2250 N. Airport Boulevard, Suite 500 Aurora, CO 80011	Tel:(303)-577-0061 Fax:(303) 577-0314 Email:denver@atosausa.com
Hayward, CA	26545 Danti Court Hayward, CA 94545	Tel:(510)-670-2951 Fax: (510)-670-2950 Email:sf@atosausa.com
Homer Glen, IL	14503 Gougar Rd. Suite 700, Lockport, IL 60441	Tel:(815)-838-9503 Fax:(815)-838-9504 Email:chicago@atosausa.com
Houston, TX	16420 West Hardy Rd., Suite 245 Houston, TX 77060	Tel:(281)-877-0200 Fax:(281)-877-4165 Email: houston@atosausa.com
Kent, WA	6920 South 212th St., Kent, WA 98032	Tel:(253)-236-5295 Fax:(844)-585-7245 Email:seattle@atosausa.com
Lakeland, FL	9201 King Palm Drive, Suite A, Tampa, FL 33619	Tel:(863)-698-7905 Fax:(863)-698-7906 Email:orlando@atosausa.com
Fairfield, NJ	12 Gardner Rd. Fairfield, NJ 07004	Tel:(201)-355-8257 Fax:(201)-355-8810 Email:nj@atosausa.com
Groveport, OH	5700 North Green Pointe Drive Suite C Groveport, OH 43125	Tel:(614)-567-6186 Fax:(614)-567-6163 Email:ohio@atosausa.com



Contents

Range (ATO-4B)
Range (ATO-6B)
Range (ATO-10B)
Range (ATO-4B12G)
Range (ATO-4B36G)
Range (ATO-6B24G)
Range (ATO-12G4B)
Range (ATO-2B24G)
Range (ATO-2B48G)
Range (ATO-24G)
Range (ATO-24G6B)
Range (ATO-24G2B)
Range (ATO-36G)
Range (ATO-36G4B)
Range (ATO-48G2B)



TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosau.com | www.atosausa.com | california,Colorado,Florida,Georgia,Illinois,Massachusetts,New Jersey,Ohio,Texas, Washington

Range (ATO-4B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor









Specifications

Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)	Griddle working area(inch)	Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	4									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	0	124000	1	20*26*14	None	4pcs 11 4/5*11	Pilot liaht	Only the	302	24*31
l NG		ivialidally	Griddle I-SHAPE	NG45	21000	0	124000	'	20 20 14	None	4/5	1 llot light	oven	302	*56 3/8	
			I-SHAPE Oven	NG44	24000	1										
			Hot	plates	LP54	23000	4									
LP	10	Manually	Hot plates U-SHAPE	LP52	27000	0	116000	1	20*26*14	None	4pcs 11 4/5*11	Pilot light	Only the	302	24*31	
"	10	ivialidally	Griddle U-SHAPE I-SHAPE	LP54	21000	0	110000	'	20 20 14	None	4/5	1 llot light	oven	302	*56 3/8	
			C	Oven	LP53	24000	1									





ATOSA CATERING EQUIPMENT INC. 01





Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Range (ATO-6B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor










Specifications

Gas ty	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	6									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	0	177000	1	26	None	6pcs 11 4/5*11	Pilot light	Only the	406	36*31
l NG		Iviariaariy	Gridale	I-SHAPE	NG45	21000	0	177000	'	1/2 *26*14	None	4/5	1 llot light	oven	400	*56 3/8
			C	Oven	NG39	27000	1									
			Hot	plates	LP54	23000	6									
IP	10	Manually	Griddle	U-SHAPE	LP52	27000	0	165000	1	26	None	6pcs 11 4/5*11	Pilot light	Only the	406	36*31
"	10	Iviariually	Gridale	I-SHAPE	LP54	21000	0	103000	'	1/2 *26*14	None	4/5	1 llot light	oven	400	*56 3/8
			C	Oven	LP52	27000	1									





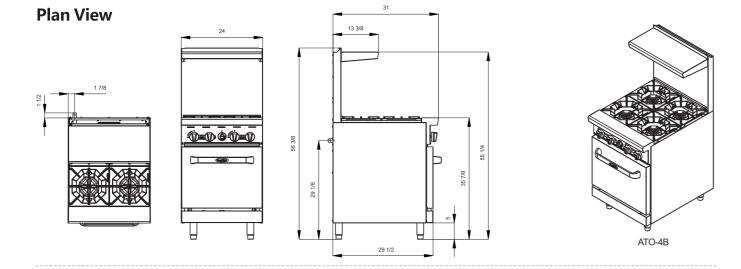

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$


The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-0399

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.



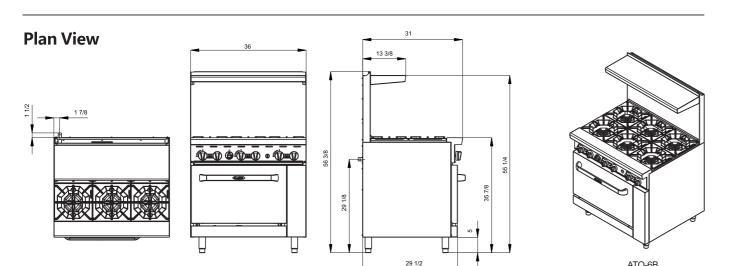

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

WHAT IS WARRANTED AND FOR HOW LONG:

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.



TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Range (ATO-10B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor















Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)	Griddle working area(inch)	Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	10									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	0	304000	2	26	None	10pcs 11 4/5*11	Pilot liaht	Only the	739	60*31
I NG		ivialidally	Griddle I-SHAPE	NG45	21000	0	304000		1/2 *26*14	None	4/5	1 llot light	oven	739	*56 3/8	
			C	I-SHAPE Oven	NG39	27000	2									
			Hot	plates	LP54	23000	10									
LP	10	Manually	Hot plates U-SHAPE	LP52	27000	0	284000	2	26	None	10pcs 11 4/5*11	Pilot light	Only the	739	60*31	
	'0	ividitudily	Griddle U-SHAPE	LP54	21000	0	204000	2	1/2 *26*14	None	4/5	i nochgrit	oven	139	*56 3/8	
			C	Oven	LP52	27000	2									










Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Plan View

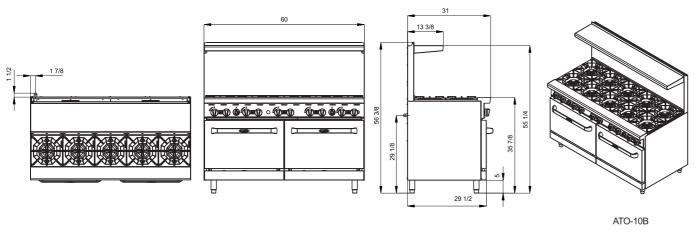

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-0399

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

Range (ATO-4B12G)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor














Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)		Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	4									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	0	148000	1	26	12*20 5/8	4pcs 11 4/5*11	Pilot light	Only the	437	36*31
I NG		ivialidally	Griddle I-SHAPE	NG45	21000	1	140000	'	1/2 *26*14	12 20 3/6	4/5	1 llot light	oven	437	*56 3/8	
			C	Oven	NG39	27000	1									
			Hot	plates	LP54	23000	4									
LP	10	Manually	Hot plates U-SHAPE	LP52	27000	0	140000	1	26	12*20 5/8	4pcs 11 4/5*11	Pilot light	Only the	437	36*31	
"	10	ivialidally	Griddle U-SHAPE I-SHAPE	LP54	21000	1	140000	'	1/2 *26*14	12 20 3/6	4/5	1 llot light	oven	437	*56 3/8	
				Oven	LP52	27000	1									







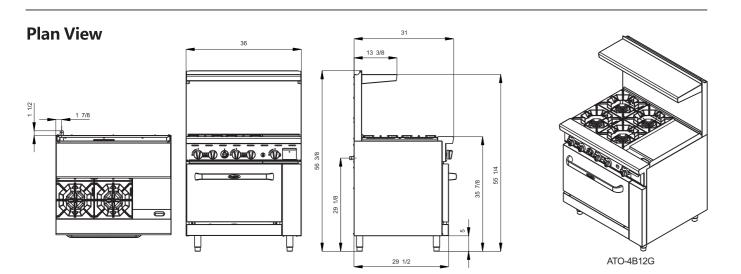

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-0390

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.



TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Range (ATO-4B36G)

Standard Features

- Stainless steel front, back, sides, kick plate including back quard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor













Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)	Griddle working area (inch)	Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	4									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	2	229000	2	26	36*20 5/8	4pcs 11 4/5*11	Pilot light	Only the	761	60*31
I NG		ivialidally	Griddle I-SHAPE	NG45	21000	1	229000		1/2 *26*14	30 20 3/0	4/5	1 llot light	oven	701	*56 3/8	
			Oven Oven	NG39	27000	2										
			Hot	plates	LP54	23000	4									
LP	10	Manually	Hot plates U-SHAPE	LP52	27000	2	221000	2	26	36*20 5/8	4pcs 11 4/5*11	Pilot light	Only the	761	60*31	
	'0	ivialiually	Griddle U-SHAPE	LP54	21000	1	221000	2	1/2 *26*14	30 20 3/6	4/5	i nochgric	oven	761	*56 3/8	
			C	Oven	LP52	27000	2									






CookRite

TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Plan View

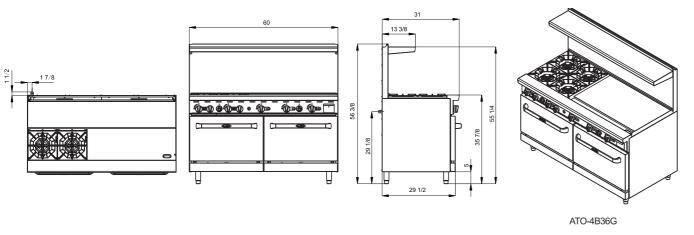

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-0399

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

Range (ATO-6B24G)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor













Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	6									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	1	252000	2	26	24*20 5/8	6pcs 11 4/5*11	Pilot light	Only the	734	60*31
ING		ivialidally	Griddle I-SHAPE	NG45	21000	1	232000		1/2 *26*14	24 20 3/0	4/5	1 llot light	oven	7.54	*56 3/8	
			I-SHAPE Oven	NG39	27000	2										
			Hot	plates	LP54	23000	6									
LP	10	Manually	Hot plates U-SHAP	U-SHAPE	LP52	27000	1	240000	2	26	24*20 5/8	6pcs 11 4/5*11	Pilot light	Only the	734	60*31
LP	10	ivialiualiy	Griddle I-SHAPE	LP54	21000	1	240000		1/2 *26*14	24 20 3/6	4/5	Filotilgrit	oven	734	*56 3/8	
			C	Oven	LP52	27000	2									










Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com California,Colorado,Florida,Georgia, Illinois,Massachusetts,New Jersey,Ohio,Texas,

Plan View

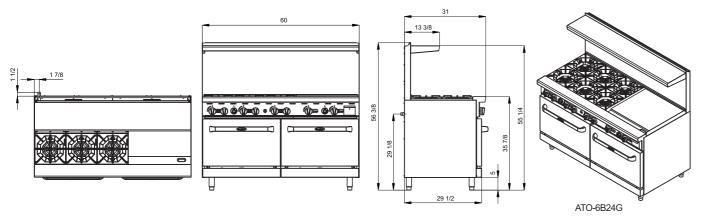

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

Range (ATO-12G4B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor











Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)	Griddle working area (inch)	Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	4									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	0	148000	1	26	12*20 5/8	4pcs 11 4/5*11	Pilot liaht	Only the	437	36*31
I NG		ivialidally	Griddle I-SHAPE	NG45	21000	1	140000	'	1/2 *26*14	12 20 3/6	4/5	1 llot light	oven	437	*56 3/8	
			C	I-SHAPE Oven	NG39	27000	1									
			Hot	plates	LP54	23000	4									
LP	10	Manually	Hot plates U-SHAPE	LP52	27000	0	140000	1	26	12*20 5/8	4pcs 11 4/5*11	Pilot light	Only the	437	36*31	
"	10	ivialidally	Griddle U-SHAPE I-SHAPE	LP54	21000	1	140000	'	1/2 *26*14	12 20 3/6	4/5	1 llot light	oven	437	*56 3/8	
			C	Oven	LP52	27000	1									








TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosausa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

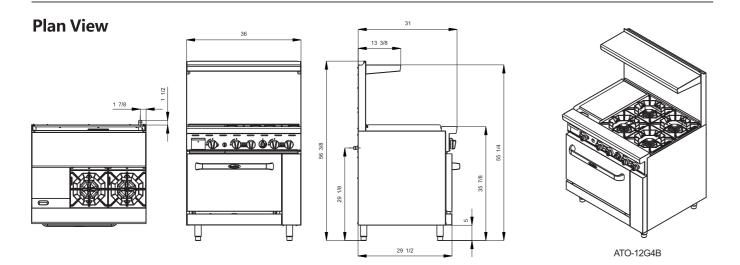

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-0390

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

Range (ATO-2B24G)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor






Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	2									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	1	125000	1	26	24*20 5/8	2pcs 11 4/5*11	Pilot light	Only the	463	36*31
ING		ivialidally	Griddle I-SHAPE	NG45	21000	1	123000	'	1/2 *26*14	24 20 3/6	4/5	1 llot light	oven	403	*56 3/8	
			C	Oven	NG39	27000	1									
			Hot	plates	LP54	23000	2									
LP	10	Manually	Hot plates U-SHAPE	LP52	27000	1	121000	1	26	24*20 5/8	2pcs 11 4/5*11	Pilot light	Only the	463	36*31	
"	10	ivialidally	Griddle U-SHAPE I-SHAPE	LP54	21000	1	121000	'	1/2 *26*14	24 20 3/6	4/5	1 llot light	oven	403	*56 3/8	
			C	Oven	LP52	27000	1									







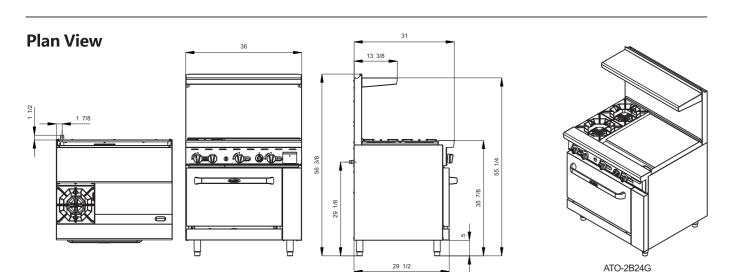

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

WHAT IS WARRANTED AND FOR HOW LONG:

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.



TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas,

Range (ATO-2B48G)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor















Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	2									
NG	5	Manually	Griddle U-SHAPE	NG42	27000	3	206000	2	26	48*20 5/8	2pcs 11 4/5*11	Pilot light	Only the	783	60*31	
ING	5	ivialiually	Gridale	I-SHAPE	NG45	21000	1	200000		1/2 *26*14	40 20 3/0	4/5	rilotilgrit	oven	763	*56 3/8
			I-SHA Oven	Oven	NG39	27000	2									
			Hot	plates	LP54	23000	2									
IP	10	Manually	i	U-SHAPE	LP52	27000	3	202000	2	26	48*20 5/8	2pcs 11 4/5*11	Pilot light	Only the	783	60*31
	10	iviaiiually	Gridale	I-SHAPE	LP54	21000	1	202000	2	1/2 *26*14	40 20 5/8	4/5	Fliotilgrit	oven	183	*56 3/8
			C	Oven	LP52	27000	2									








CookRite

TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Plan View

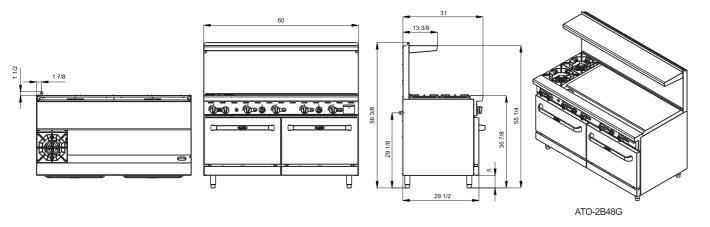

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

Range (ATO-24G)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor














Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burn	er name	Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot	plates	NG45	25000	0									
NG	5	Manually	Criddlo	U-SHAPE	NG42	27000	1	72000	1	20*26*14	24*20 5/8	None	Pilot light	Only the	362	24*31
I NG		ivialidally	Griddle I-SHAPE	NG45	21000	1	72000	'	20 20 14	24 20 3/0	None	1 llot light	oven	302	*56 3/8	
			C	Oven	NG44	24000	1									
			Hot	plates	LP54	23000	0									
LP	10	Manually	Hot plates U-SHAPE	LP52	27000	1	72000	1	20*26*14	24*20 5/8	None	Pilot light	Only the	362	24*31	
LP	10	ivialiually	Griddle U-SHAPE I-SHAPE	LP54	21000	1	72000	'	20 26 14	24 20 3/6	None	Filotilgrit	oven	362	*56 3/8	
			C	Oven	LP53	24000	1									









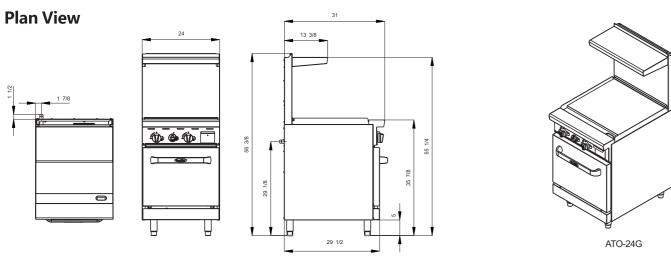

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

WHAT IS WARRANTED AND FOR HOW LONG:

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.



TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas,

Range (ATO-24G6B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor















Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burner name		Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)	Griddle working area (inch)	Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot plates		NG45	25000	6									
NG	5	Manually	Criddle	U-SHAPE	NG42	27000	1	252000	2	26 1/2 *26*14	24*20 5/8	6pcs 11 4/5*11 4/5	Pilot light	Only the oven	734	60*31
I NG		ivialidally	Gridale	I-SHAPE	NG45	21000	1									*56 3/8
			Oven		NG39	27000	2									
			Hot plates		LP54	23000	6									
LP	10	Manually	Griddle	U-SHAPE	LP52	27000	1	240000	2	26 1/2 *26*14	24*20 5/8	6pcs 11 4/5*11 4/5	Pilot light	Only the oven	734	60*31
LP 10	10	ivialiually	Gridale	I-SHAPE	LP54	21000	1									*56 3/8
			C	ven	LP52	27000	2									










Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Plan View

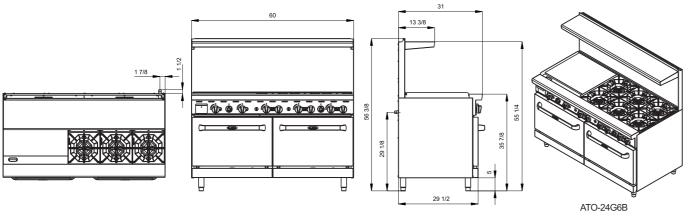

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES. EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

WHAT IS WARRANTED AND FOR HOW LONG:

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

Range (ATO-24G2B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor














Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burner name		Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)	Griddle working area (inch)	Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot plates		NG45	25000	2									
NG	5	Manually	Criddle	U-SHAPE	NG42	27000	1	125000	1	26 1/2 *26*14	24*20 5/8	2pcs 11 4/5*11 4/5	Pilot light	Only the oven	463	36*31
		ivialidally	Gridale	I-SHAPE	NG45	21000	1									*56 3/8
			Oven		NG39	27000	1									
			Hot plates		LP54	23000	2									
LP	10	Manually	Griddle	U-SHAPE	LP52	27000	1	121000		26 1/2 *26*14	24*20 5/8	2pcs 11 4/5*11 4/5	Pilot light	Only the oven	463	36*31
	10	ivialiually	Griddle	I-SHAPE	LP54	21000	1		'							*56 3/8
			C	Oven	LP52	27000	1									







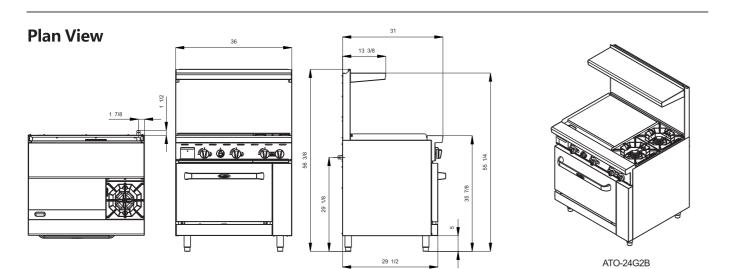

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

WHAT IS WARRANTED AND FOR HOW LONG:

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.



TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Range (ATO-36G)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor
















Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burner name		Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
		Manually	Hot plates		NG45	25000	0									
NG	5		Criddle	U-SHAPE	NG42	27000	2	102000	1	26 1/2 *26*14	36*20 5/8	None	Pilot light	Only the oven	487	36*31
NG		ivialiually	Gridale	I-SHAPE	NG45	21000	1									*56 3/8
			Oven		NG39	27000	1									
			Hot plates		LP54	23000	0									
	10	Manually	Criddle	U-SHAPE	LP52	27000	2	102000		26 1/2 *26*14	36*20 5/8	None	Pilot light	Only the oven	487	36*31 *56 3/8
LP		ivialiualiy	Griddle	I-SHAPE	LP54	21000	1		1							
			C	ven	LP52	27000	1									







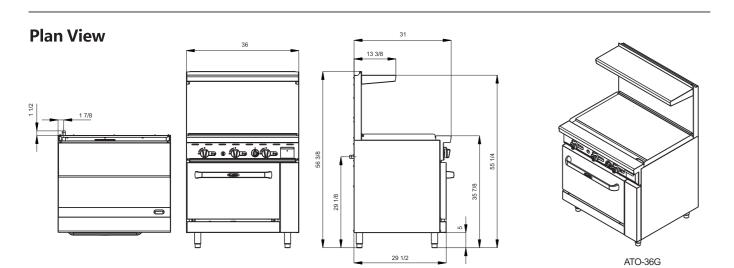

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES. EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

WHAT IS WARRANTED AND FOR HOW LONG:

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.



TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosa.com | www.atosausa.com California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas,

Range (ATO-36G4B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor











Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burner name		Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot plates		NG45	25000	4									
NG	5	Manually	Criddle	U-SHAPE	NG42	27000	2	229000	2	26 1/2 *26*14	36*20 5/8	4pcs 11 4/5*11 4/5	Pilot light	Only the oven	761	60*31
I NG		ivialidally	Gridale	I-SHAPE	NG45	21000	1									*56 3/8
			Oven		NG39	27000	2									
			Hot plates		LP54	23000	4									
LP	10	Manually	Griddle	U-SHAPE	LP52	27000	2	221000	2	26 1/2 *26*14	36*20 5/8	4pcs 11 4/5*11 4/5	Pilot light	Only the oven	761	60*31
	10	ivialidally	Gridale	I-SHAPE	LP54	21000	1									*56 3/8
			C	Oven	LP52	27000	2									





ATO-36G4B

CookRite

TO COOK NICELY!

Toll Free:855-855-0399 Email:info@atosausa.com www.atosausa.com | www.atosausa.com | California, Colorado, Florida, Georgia, Illinois, Massachusetts, New Jersey, Ohio, Texas, Washington

Plan View 17/8 17/8 19/9 1

Terms and Conditions

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

$\underline{\textbf{WHAT IS WARRANTED AND FOR HOW LONG:}}$

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

Range (ATO-48G2B)

Standard Features

- Stainless steel front, back, sides, kick plate including back guard and high shelf
- Heavy duty lift off cast iron burners rated at 25,000 BTU/hr
- 12"×12"cast iron top grates
- Oven burner rated at 27,000 BTU/hr
- Oven pilot with 100% safety shut off
- Multiple position oven rack guides
- One chrome rack per oven
- Stainless steel tubing for burners and pilots
- 3/4" thick polished steel griddle plate
- 1 year parts and labor














Gas type	Intake-tube Pressure (in.W.C.)	Ignition Way	Burner name		Nozzle No	Per BTU B.T.U./h	Burners QTY (pcs)	Total BTU B.T.U./h	Oven QTY	Oven size(inch)		Hot plates working area (inch)	Valve Types	Temp. Control	Net Weight (LBS)	Exterior Size(inch)
			Hot plates		NG45	25000	2									
NG	5	Manually	Criddle	U-SHAPE	NG42	27000	3	206000	2	26 1/2 *26*14	48*20 5/8	2pcs 11 4/5*11 4/5	Pilot light	Only the oven	783	60*31
		ivialidally	Gridale	I-SHAPE	NG45	21000	1									*56 3/8
			Oven		NG39	27000	2									
			Hot plates		LP54	23000	2									
LP	10	Manually	Criddle	U-SHAPE	LP52	27000	3	202000		26 1/2 *26*14	48*20 5/8	2pcs 11 4/5*11 4/5	Pilot light	Only the oven	783	60*31 *56 3/8
LP	10	ivialidally	Griddie	I-SHAPE	LP54	21000	1		2							
			C	Oven	LP52	27000	2									









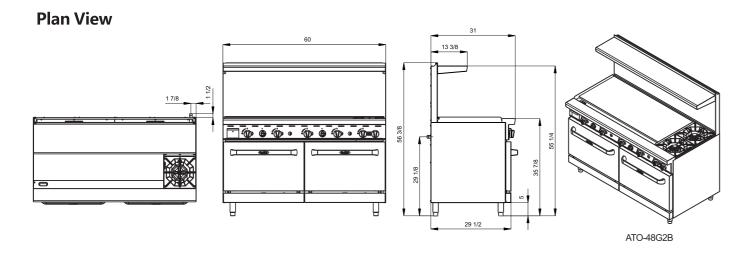

1 YEAR WARRANTY

All claims for parts or labor must be made directly to Atosa. All claims must include: model number of the unit, serial number, proof of purchase, date of installation, and all pertinent information supporting the alleged defect. Failure to comply with warranty policies will result in voiding claims.

Atosa warrants all new gas components to be free from defects in materials or workmanship. Atosa's obligation under this warranty is limited to a period of 1 year from the original installation. All parts covered under this warranty that are defective within 1 year of the original installation are limited to repair or replacement (Including labor charges, of defective parts or assemblies) The labor warranty shall include standard straight time labor charges only and reasonable travel time, as determined by Atosa.

NO CONSEQUENTIAL DAMAGES: ATOSA IS NOT RESPONSIBLE FOR ECONOMIC LOSS; PROFIT LOSS; OR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, INCLUDING WITHOUT LIMITATION, LOSSES, OR DAMAGES ARISING FROM FOOD OR PRODUCT SPOILAGE, REGARDLESS OF WHETHER OR NOT THEY RESULT FROM REFRIGERATION FAILURE.

WARRANTY IS NOT TRANSFERABLE: This warranty is not assignable and applies only in favor of the original purchaser/user to whom delivered. ANY SUCH ASSIGNMENT OR TRANSFER SHALL VOID THE WARRANNTIES HEREIN AND SHALL VOID ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY WARRANTY OF MERCHANTABILITY OR LABOR COVERAGE FOR COMPONENT FAILURE OR OTHER THE WARRANTY PACKET PROVIDED WITH THE UNIT.

ALTERATION, NEGLECT, ABUSE, MISUSE, ACCIDENT, DAMAGE DURING TRANSIT OR INSTALLATION, FIRE, FLOOD, OR ACTS OF GOD: Atosa is not responsible for the repair or replacement of any parts that are determined to have been subjected after the date of manufacture to alteration, neglect, abuse, misuse, accident, damage during transit or installation, fire, flood, or acts of God.

WHAT IS WARRANTED AND FOR HOW LONG:

The Product's cast-iron grates, stainless steel radiants, and briquettes are warranted not to fail as a result of defects in materials or workmanship in normal use for a period of one year from the date of purchase. Atosa agrees to repair or replace, at its option, the above warranted parts or items that fails due to defects in materials or workmanship during the warranted period. To obtain warranty service, the Purchaser must contact Atosa toll free (855) 855-0399

THE ONE YEAR PARTS & LABOR WARRANTY ARE AS DESCRIBED ABOVE. THESE WARRANTIES ARE EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES, INCLUDING IMPLIED WARRANTY AND MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. THERE ARE NO WARRANTIES WHICH EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

Outside U.S. and Canada: This warranty does not apply to areas outside the continent of the United States. Atosa is not responsible for any warranty claims made on products sold or used in such areas.

In some cases, a 25% restocking fee may be charged to a buyer for returned items.

30 Atosa International Atosa USA www.atosa.com www.atosa.com

Smart Kitchen Service

Dear Atosa User:

We are incredibly proud to announce our very own in-house service department. At Smart Kitchen Service, our staff is dedicated to providing our customers with services and products exceeding their expectations. At Smart Kitchen Service, we pride ourselves on delivering superior customer service by providing a steady communication between our service agents and our customers. Our unique ability to provide customers with same day customers service, gives us an edge over our competition. At Smart Kitchen Service every one of our customers is assigned to a specific customer service representative, who directly oversees every service call and its progress from start to finish. The direct involvement of our customer service team allows Smart Kitchen Service to remain flexible and tailor our service to suit the needs of our customers. When you need a solution our customer service representatives are there to help you find it. We make your satisfaction and continued business our priority!

Our service director has a life time experience. He has spent a career in commercial food service manufacturing roles. He began as a quality control engineer, and was promoted to a director of product quality and product services, and he has personally trained each one of our service agents individually, to make sure we provide you with the ultimate customer service experience.

We will not rest, until our customers are 100% satisfied.

Toll Free: 800-683-8660

East Coast Service Representative:

Ext. 104 & Ext. 109

West Coast Service Representative:

Ext. 103& Ext. 110

Central Service Representative:

Ext. 105& Ext. 108